

September 5, 2022

Version 1

Manual Transmission Will Not Shift, the Clutch is Slipping, or the Vehicle Won't Move When in Gear

AFFECTED VEHICLES

Year	Model	Trim	VIN Range
2020 – 2021	Civic (1.5L T Engine)	LX, EX, Sport, Si (with M/T)	ALL

SYMPTOM

Customer complains that the manual transmission will not shift, the clutch is slipping, or the vehicle won't move when in gear.

POSSIBLE CAUSE

Due to supplier production issues, the friction disc material may have prematurely worn.

CORRECTIVE ACTION

Replace the flywheel, pressure plate, friction disc (Clutch), and release bearing.

PARTS INFORMATION

Part Name	Part Number	Quantity
FLYWHEEL	22100-5CD-018	1
FRICION DISK	22200-5CC-003	1
PRESSURE DISK	22300-5CC-003	1
CLUTCH RELEASE BEARING	22810-57A-006	1
SET-RING (28MM X 2.0MM)	44319-S1A-E01	1
SPINDLE NUT (24MM)	90305-SD4-003	2
FLANGE BOLT (14MM X 90MM)	90179-SDA-A00	4
FLANGE BOLT (14MM X 45MM)	90163-TBA-A00	2
GEAR BOX MOUNTING BOLT	90108-TL1-G00	1

CUSTOMER INFORMATION: The information in this bulletin is intended for use only by skilled technicians who have the proper tools, equipment, and training to correctly and safely maintain your vehicle. These procedures should not be attempted by "do-it-yourselfers," and you should not assume this bulletin applies to your vehicle, or that your vehicle has the condition described. To determine whether this information applies, contact an authorized Honda automobile dealer.

Part Name	Part Number	Quantity
FLANGE BOLT (10MM X 65MM)	90210-TBA-A01	2
FLANGE BOLT (14MM X 35MM)	90181-TBA-A00	2
SELF-LOCK NUT (12MM) (CLINCH)(SATO RASHI)	90215-SB0-003	6
FLANGE NUT (10MM)	90002-S10-000	2
SELF-LOCK NUT (10MM)	90212-SA5-003	8
SPLIT PIN (3.0MM X 22MM)	94201-30220	2
EXHAUST PIPE GASKET	18302-SP0-003	1
EXHAUST PIPE GASKET	18303-T2B-A01	2
FLANGE NUT (12MM)	90371-TBA-A00	2
FLANGE BOLT (12MM X 50MM)	90167-TBA-A00	2
FLANGE BOLT (14MM X 33MM)	90164-T6E-000	5
SEALING WASHER (6MM)	90442-R7G-000	1
DRAIN PLUG WASHER (20MM)	94109-20000	1

REQUIRED MATERIALS

Part Name	Part Number	Quantity
Super high temp urea grease (Will repair 10 vehicles)	08798-9002	1
UM246 (Will repair 10 vehicles)	41211-PY5-305	1
Moly 60 paste (Will repair 10 vehicles)	08734-0001	1
Honda MTF (1 qt)	08798-9031	3

TOOLS INFORMATION

Part Name	Part Number
Universal Lifting Eyelet	07AAK-SNAA120
Engine Support Hanger, A and Reds	AAR-T1256
Subframe Alignment Pin	070AG-SJAA10S
Subframe Adapter	VSB02C000016
Ball Joint Thread Protector, 12 mm	07AAF-SDAA100
Ball Joint Remover, 28 mm	07MAC-SL00202
Ring Gear Holder Attachment	070AB-5S10100

Part Name	Part Number
Ring Gear Holder	07LAB-PV00100
Remover Handle	07936-3710100
Shaft, Clutch Align	07ZAF-PR8A100


WARRANTY CLAIM INFORMATION

The normal warranty applies.

Operation Number	Description	Flat Rate Time	Defect Code	Symptom Code	Template ID	Failed Part Number
2101J3	Replace the Flywheel, Pressure plate, Friction Disc, and release bearing. (Includes alignment and steering relearn)	5.3 hr	00504	03217	A22017A	22200-5CC-003

REPAIR PROCEDURE

1. Support and raise the vehicle:
 - 1.1. Position the lift pads under the vehicle's front support points and rear support points.

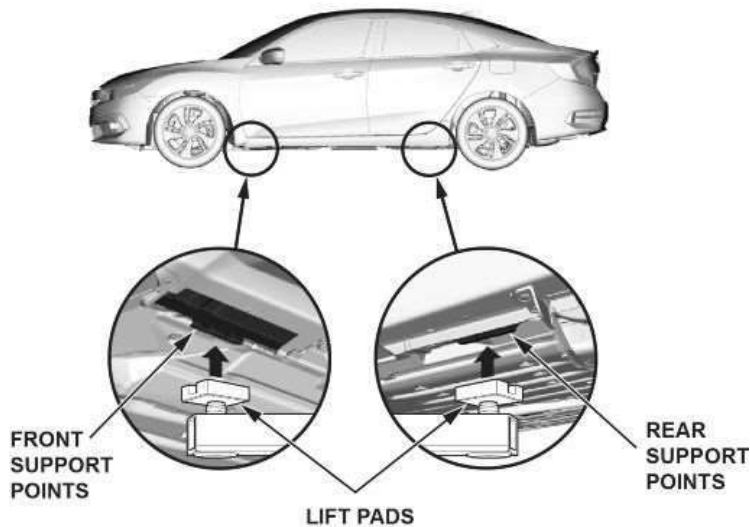

- 1.2. Raise the lift a few inches, and rock the vehicle gently to be sure it is firmly supported.
- 1.3. Raise the lift to a comfortable working height and inspect the vehicle support points for solid contact with the lift pads