

Spotlight Lens Sticks

SYMPTOM

When the customer pushes on either the left or right lens to turn on a spotlight, it does not pop back out.

PROBABLE CAUSE

Headliner material is interfering with the lens, preventing it from moving freely.

VEHICLES AFFECTED

KK: From VIN 1HGES1...1L500001 thru 1HGES1...1L500717

KX: From VIN 1HGES1...1L900001 thru 1HGES1...1L902360

KA: ALL

CORRECTIVE ACTION

Reposition the spotlight assembly. If necessary, remove some headliner material.

WARRANTY CLAIM INFORMATION

In warranty: The normal warranty applies.


Flat Rate Time: 0.2 hour

Failed Part: P/N 34403-S5A-003ZB

Defect Code: 030

REPAIR PROCEDURE

1. Remove each lens by carefully prying on the inside edge with a small screwdriver.
2. Loosen the spotlight assembly mounting screws.
3. Move the spotlight assembly away from the side that was sticking. If the left lens was sticking, move the assembly to the right and vice versa. Tighten the mounting screws.

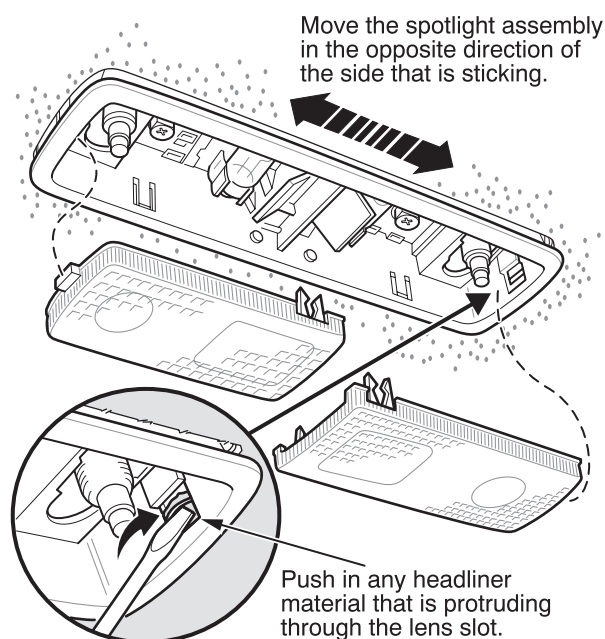

4. Use a small screwdriver to push back any headliner material that is interfering with the lens slot.
5. Reinstall the lenses and test the light.
 - If the lens no longer sticks, the repair is complete.
 - If the lens still sticks, remove the spotlight assembly and use a razor blade to trim the headliner material.